


Date: 14th October 1996

---

## EVENT PLUS KEYPAD FLASH

Under certain conditions the LEDs in the keypad buttons of the Event Plus console momentarily flash. This appears at random and has no adverse effect on the console operation, however it can be a distraction to the user. To fix this the CPU card needs to be modified as follows:

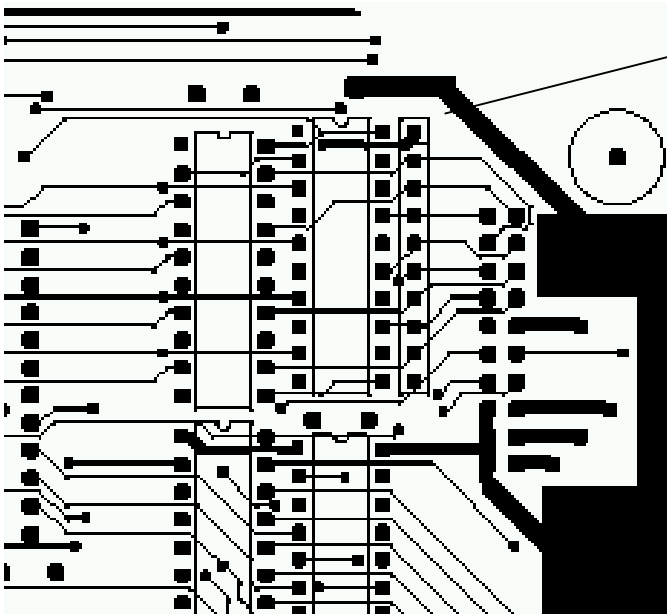

1. Remove CPU card.
2. Locate RS5 located between CN2 and IC14.
3. Cut track leading to pin 1 of RS5.
4. Link pin 1 RS5 to thick ground track nearby.

View From Solder Side