



Date: 11 March 97

HPDimmer Deep Clear Software Bugs

The following software bugs have been reported in the HP dimmer software up to and including version 1.2C.

1. At the conclusion of the Deep Clear sequence the outputs occasionally flash briefly to 240V, including those channels set to 120V. To prevent any possible damage to 120V lamps or other low voltage loads connected to the outputs ensure that the circuit breakers are switched off when performing a deep clear.
2. When an HP6 is deep cleared, some channels may turn on and remain on at the conclusion of the deep clear sequence. To clear this state cycle the main power to the dimmer ie. Turn the power off then on.

To avoid damage to any loads connected to the output ensure that the channel circuit breakers are switched off until the power cycle sequence detailed above is performed.